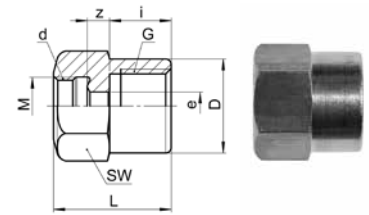
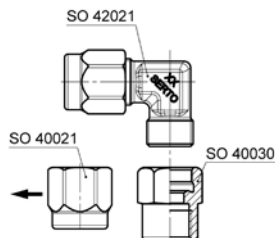


# Übergangsmuffe Adaptateur femelle Female adaptor


**SO 40030**


Type -d -G	Mat.-Nr.	bar	M	SW	L	D	i	z	e	kg/100
G=Rohrgewinde (zylindrisch)	G=Filetage-gaz BSP (cylindrique)		G=BSP thread (parallel)							
SO 40030-6-1/8	016.0301.100	250	10x1.0	14	20.0	13.8	10.0	4.0	5.0	1.670
SO 40030-6-1/4	016.0301.110	250	10x1.0	17	21.0	16.8	11.0	4.0	5.0	2.530
SO 40030-6-3/8	016.0301.120	250	10x1.0	22	22.0	21.8	12.0	4.0	5.0	4.800
SO 40030-8-1/8	016.0301.160	150	12x1.0	17	21.0	16.8	10.0	4.0	6.5	2.790
SO 40030-8-1/4	016.0301.170	150	12x1.0	17	23.0	16.8	11.0	5.0	6.5	2.540
SO 40030-8-3/8	016.0301.180	150	12x1.0	22	23.0	21.8	12.0	4.0	6.5	4.780
SO 40030-10-1/4	016.0301.270	125	14x1.0	17	22.0	16.8	11.0	4.0	8.5	2.090
SO 40030-10-3/8	016.0301.280	125	14x1.0	22	23.0	21.8	12.0	5.0	8.5	4.760
SO 40030-12-1/4	016.0301.380	100	16x1.0	19	22.0	18.8	11.0	4.0	10.5	2.780
SO 40030-12-3/8	016.0301.390	100	16x1.0	22	23.0	21.8	12.0	4.0	10.5	4.090
SO 40030-12-1/2	016.0301.400	100	16x1.0	27	25.0	26.8	14.0	4.0	10.5	7.270
SO 40030-15-3/8	016.0301.532	40	20x1.5	24	25.0	23.8	12.0	5.0	13.0	5.100
SO 40030-15-1/2	016.0301.534	40	20x1.5	27	27.0	26.8	14.0	5.0	13.0	7.130
SO 40030-15-3/4	016.0301.536	40	20x1.5	32	30.0	31.8	17.0	5.0	13.0	10.980
SO 40030-18-1/2	016.0301.646	40	24x1.5	30	28.0	29.8	14.0	6.0	15.0	9.410
SO 40030-18-3/4	016.0301.648	40	24x1.5	32	31.0	31.8	17.0	6.0	15.0	10.350
SO 40030-22-3/4	016.0301.768	25	28x1.5	36	31.0	35.8	17.0	6.0	19.0	14.320
SO 40030-28-1	016.0301.850	16	36x2.0	41	37.0	40.8	20.0	7.0	25.0	16.700
SO 40030-35-1 1/4	016.0301.944	16	42x2.0	50	41.0	49.8	22.0	7.0	31.0	27.400

**Anwendungsbeispiele:**


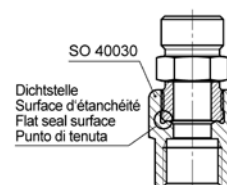
Die Übergangsmuffe kann auf jedes SERTO-Formteil mit dem passenden zylindrischen Gewinde geschraubt werden und muss mit 1/4 Umdrehung angezogen werden.

Dichtungsprinzip: Bei der Montage drückt sich die Dichtkante des Übergangsstückes in das SERTO-Formteil ein, dadurch entsteht eine einwandfreie Dichtung.  
Wir empfehlen, das Gewinde mit einem geeigneten Flüssigklebstoff gegen unbeabsichtigtes Lösen zu sichern.

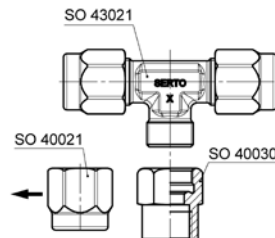**Exemples d'utilisation:**


L'adaptateur femelle peut être vissé à toute pièce moulée SERTO avec le filetage cylindrique approprié et doit être serré de 1/4 de tour.

Principe d'étanchéité: Lors de l'assemblage, l'arête d'étanchéité de l'adaptateur appuie sur la pièce moulée SERTO, créant ainsi une étanchéité parfaite.  
Nous recommandons de fixer le filetage avec une colle liquide appropriée pour empêcher le desserrage involontaire.

**Sample combinations:**


The female adaptor can be screwed onto all SERTO moulded parts with a matching cylindrical thread and must be tightened with 1/4 turn.

Sealing principle: During assembly, the sealing edge of the female adaptor presses into the SERTO moulded part to produce a perfect seal.  
We recommend that the thread is secured against accidental unscrewing by means of a suitable liquid adhesive.