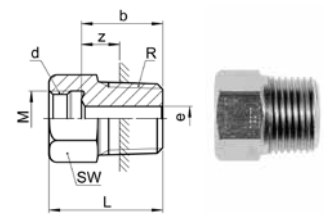
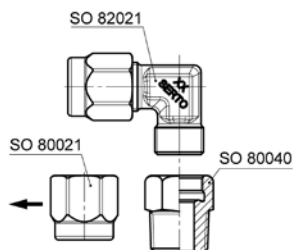


# Übergangsnippel Adaptateur femelle - mâle Male adaptor

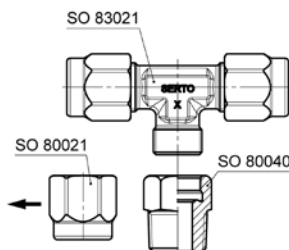

**SO 80040**

Type -d-R	Mat.-Nr.	bar	M	SW	L	b	z	e	kg/100
R=Rohrgewinde (kegelig)	R=Filetage-gaz BSP (conique)		R=BSP thread (tapered)						
SO 80040-6-1/8	036.0401.100	125	10x1.0	12	17.0	11.0	6.0	5.0	0.800
SO 80040-6-1/4	036.0401.110	125	10x1.0	14	21.0	15.0	7.0	5.0	1.850
SO 80040-6-3/8	036.0401.120	125	10x1.0	17	20.0	14.0	6.0	5.0	2.440
SO 80040-8-1/8	036.0401.160	80	12x1.0	14	18.0	11.0	6.0	6.5	0.990
SO 80040-8-1/4	036.0401.170	80	12x1.0	14	22.0	15.0	7.0	6.5	1.520
SO 80040-10-1/4	036.0401.270	60	14x1.0	17	22.0	15.0	7.0	8.5	1.710
SO 80040-10-3/8	036.0401.280	60	14x1.0	17	22.0	15.0	7.0	8.5	2.440
SO 80040-10-1/2	036.0401.285	60	14x1.0	22	23.0	16.0	6.0	8.5	5.030
SO 80040-12-1/4	036.0401.380	40	16x1.0	19	23.0	16.0	8.0	8.5	2.110
SO 80040-12-3/8	036.0401.390	40	16x1.0	19	23.0	16.0	8.0	10.5	2.870
SO 80040-12-1/2	036.0401.400	40	16x1.0	22	26.0	19.0	9.0	10.5	4.840
SO 80040-15-3/8	036.0401.532	25	20x1.5	24	24.0	16.0	8.0	10.5	3.760
SO 80040-15-1/2	036.0401.534	25	20x1.5	24	28.0	20.0	10.0	13.0	4.430
SO 80040-15-3/4	036.0401.536	25	20x1.5	27	27.5	19.5	7.5	13.0	8.250
SO 80040-18-1/2	036.0401.646	25	24x1.5	30	29.0	21.0	11.0	13.0	6.010
SO 80040-18-3/4	036.0401.648	25	24x1.5	30	29.5	21.5	9.5	15.0	8.930

**Anwendungsbeispiele:**


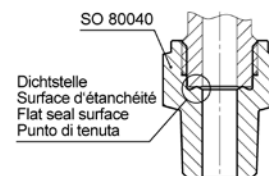
Der Übergangsnippel kann auf jedes SERTO-Formteil mit dem passenden zylindrischen Gewinde geschraubt werden und muss mit 1/4 Umdrehung angezogen werden.

Dichtungsprinzip: Bei der Montage drückt sich die Dichtkante des Übergangsstückes in das SERTO-Formteil ein, dadurch entsteht eine einwandfreie Dichtung. Wir empfehlen, das Gewinde mit einem geeigneten Flüssigklebstoff gegen unbeabsichtigtes Lösen zu sichern.

**Exemples d'utilisation:**


L'adaptateur mâle peut être vissé à toute pièce moulée SERTO avec le filetage cylindrique approprié et doit être serré de 1/4 de tour.

Principe d'étanchéité: Lors de l'assemblage, l'arête d'étanchéité de l'adaptateur appuie sur la pièce moulée SERTO, créant ainsi une étanchéité parfaite. Nous recommandons de fixer le filetage avec une colle liquide appropriée pour empêcher le desserrage involontaire.

**Sample combinations:**


The male adaptor can be screwed onto all SERTO moulded parts with a matching cylindrical thread and must be tightened with 1/4 turn.

Sealing principle: During assembly, the sealing edge of the male adaptor presses into the SERTO moulded part to produce a perfect seal. We recommend that the thread is secured against accidental unscrewing by means of a suitable liquid adhesive.