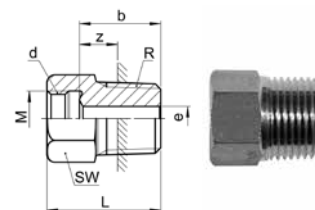
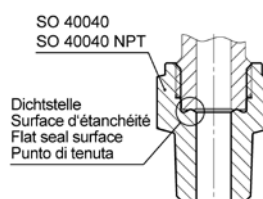
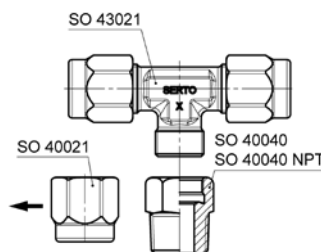
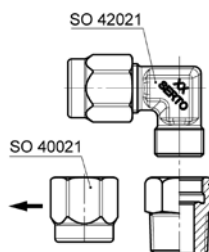


Übergangsnippel Adaptateur femelle - mâle Male adaptor


SO 40040

Type -d -R	Mat.-Nr.	bar	M	SW	L	b	z	e	kg/100
R=Rohrgewinde (kegelig)	R=Filetage-gaz BSP (conique)		R=BSP thread (tapered)						
SO 40040-6-1/8	016.0401.100	250	10x1.0	12	17.0	11.0	6.0	5.0	0.800
SO 40040-6-1/4	016.0401.110	250	10x1.0	14	21.0	15.0	7.0	5.0	1.850
SO 40040-6-3/8	016.0401.120	250	10x1.0	17	20.0	14.0	6.0	5.0	2.440
SO 40040-6-1/2	016.0401.125	250	10x1.0	22	23.0	17.0	7.0	5.0	5.700
SO 40040-8-1/8	016.0401.160	150	12x1.0	14	18.0	11.0	6.0	6.5	0.990
SO 40040-8-1/4	016.0401.170	150	12x1.0	14	22.0	15.0	7.0	6.5	1.520
SO 40040-8-3/8	016.0401.180	150	12x1.0	17	22.0	15.0	7.0	6.5	2.970
SO 40040-10-1/4	016.0401.270	125	14x1.0	17	22.0	15.0	7.0	8.5	1.710
SO 40040-10-3/8	016.0401.280	125	14x1.0	17	22.0	15.0	7.0	8.5	2.440
SO 40040-10-1/2	016.0401.285	125	14x1.0	22	23.0	16.0	6.0	8.5	5.030
SO 40040-12-1/4	016.0401.380	100	16x1.0	19	23.0	16.0	8.0	8.5	2.110
SO 40040-12-3/8	016.0401.390	100	16x1.0	19	23.0	16.0	8.0	10.5	2.870
SO 40040-12-1/2	016.0401.400	100	16x1.0	22	26.0	19.0	9.0	10.5	4.840
SO 40040-15-3/8	016.0401.532	40	20x1.5	24	24.0	16.0	8.0	10.5	3.760
SO 40040-15-1/2	016.0401.534	40	20x1.5	24	28.0	20.0	10.0	13.0	4.430
SO 40040-15-3/4	016.0401.536	40	20x1.5	27	27.5	19.5	7.5	13.0	8.250
SO 40040-18-1/2	016.0401.646	40	24x1.5	30	29.0	21.0	11.0	13.0	6.010
SO 40040-18-3/4	016.0401.648	40	24x1.5	30	29.5	21.5	9.5	15.0	8.930
SO 40040-22-1/2	016.0401.764	25	28x1.5	36	29.0	21.0	11.0	15.0	8.910
SO 40040-22-3/4	016.0401.768	25	28x1.5	36	29.5	21.5	9.5	19.0	9.480
SO 40040-28-1	016.0401.850	16	36x2.0	41	36.0	26.0	12.0	24.0	14.900
SO 40040-35-1 1/4	016.0401.944	16	42x2.0	50	42.0	30.0	16.0	31.0	26.600

Anwendungsbeispiele:
Exemples d'utilisation:
Sample combinations:


Der Übergangsnippel kann auf jedes SERTO-Formteil mit dem passenden zylindrischen Gewinde geschraubt werden und muss mit 1/4 Umdrehung angezogen werden.

Dichtungsprinzip: Bei der Montage drückt sich die Dichtkante des Übergangsstückes in das SERTO-Formteil ein, dadurch entsteht eine einwandfreie Dichtung. Wir empfehlen, das Gewinde mit einem geeigneten Flüssigklebstoff gegen unbeabsichtigtes Lösen zu sichern.

L'adaptateur mâle peut être vissé à toute pièce moulée SERTO avec le filetage cylindrique approprié et doit être serré de 1/4 de tour.

Principe d'étanchéité: Lors de l'assemblage, l'arête d'étanchéité de l'adaptateur appuie sur la pièce moulée SERTO, créant ainsi une étanchéité parfaite. Nous recommandons de fixer le filetage avec une colle liquide appropriée pour empêcher le desserrage involontaire.

The male adaptor can be screwed onto all SERTO moulded parts with a matching cylindrical thread and must be tightened with 1/4 turn.

Sealing principle: During assembly, the sealing edge of the male adaptor presses into the SERTO moulded part to produce a perfect seal. We recommend that the thread is secured against accidental unscrewing by means of a suitable liquid adhesive.